
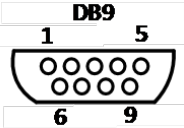



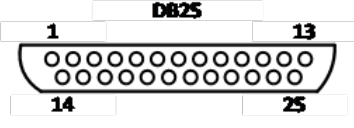
# Каталог кабелей ORDERMAN.

- Загрузить доступные материалы по этой теме.
- 1. Serial Cabel For POS
  - CB10730, CB10734
  - CB10722, CB10752
  - 502-010
  - 1639-K053, 1639-K054
  - 501-973

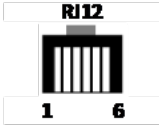
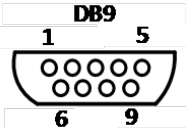
 [Загрузить доступные материалы по этой теме.](#)

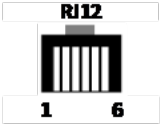
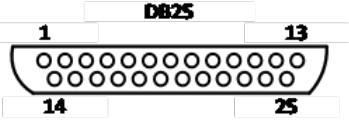
## 1. Serial Cabel For POS


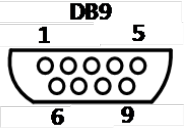
CB10730, CB10734	...30 L=700			...34 L=300
<b>CB-84 BRIO ServicE</b> Columbus 300, 400, 500, 700, 800				
	Signal	Pin	Pin	Signal
	RI	1	9	RI
	DCD	2	1	DCD
	DTR	3	4	DTR
	GND	4	5	GND
	RXD	5	2	RXD
	TXD	6	3	TXD
	CTS	7	8	CTS
	RTS	8	7	RTS
	DSR	NC	6	DSR

CB10722, CB10752	...22 L=1850			...52 L=700
Columbus 300, 400, 500, 700, 800				
	Signal	Pin	Pin	Signal
	RI	1	NC	RI
	DCD	2	NC	DCD
	DTR	3	NC	DTR
	GND	4	7	GND

	RXD	5	2	TXD
	TXD	6	3	RXD
	CTS	7	4	RTS
	RTS	8	5	CTS

<b>502-010</b>	L=1800			
Columbus 400, 700, 800, P1X30				
	<b>Signal</b>	<b>Pin</b>	<b>Pin</b>	<b>Signal</b>
	CTS	1	7	RTS
	GND	2		GND
	RXD	3	3	TXD
	TXD	4	2	RXD
	GND	5	5	GND
	RTS	6	8	CTS

<b>1639-K053, 1639-K054</b>	...53 L=1850			...54 L=910
Columbus 400 700, 800, P1X30				
	<b>Signal</b>	<b>Pin</b>	<b>Pin</b>	<b>Signal</b>
	CTS	1	4	RTS
	GND	2	H	GND
	TXD	3	2	RXD
	RXD	4	3	TXD
	GND	5	7	GND
	RTS	6	5	CTS

<b>501-973</b>	...73 L=700			
Columbus 300, 400, 500, 700, 800				
	<b>Signal</b>	<b>Pin</b>	<b>Pin</b>	<b>Signal</b>
	DSR	1	4	DTR
	DCD	2	NC	/
	DTR	3	NC	/
	GND	4	5	GND
	RXD	5	3	TXD

	TXD	6	2	RXD
	CTS	7	7	RTS
	RTS	8	8	CTS
	/	NC	9	RI